

Spectra Pro IR Series (P2230L) Cameras

This document describes the features, operational issues, and major fixes for the new Spectra Pro IR Series (P2230L) cameras. Review each section to determine if an upgrade is warranted for your installation. For additional information on the camera (including the latest updates to documentation, product specifications, and software downloads), visit the Pelco Web site at www.pelco.com.

NOTE: For technical issues, contact Pelco Product Support at 1-800-289-9100 (USA and Canada) or +1-559-292-1981 (international).

05.30.1.3 Release

New Features and Improvements

- Images uploaded to FTP servers are now high resolution.

Major Fixes

- Corrected an issue causing ONVIF profile created by SightLogix to stop working when the camera is added to Genetec.
- Corrected a problem with the Pelco logo to show a registered trademark.

05.30.1.2 Release

New Features and Improvements

- Added support for a tertiary stream.
- Added compliance with California's SB-327 cybersecurity law aimed at preventing unauthorized access to Internet-connected devices. The camera requires an administrator account to be created the first time it boots. Without such an account, the camera will not stream video and will fail most API requests.
- Added cybersecurity improvements.

Major Fixes

- Corrected an issue causing erratic zoom behavior on the camera when several ONVIF absolute PTZ commands were received.
- Corrected a problem with continuous rebooting after 700-hour Temperature, Humidity, and Bias (THB) testing.
- Corrected an issue causing the iris not to reset after a PTZ movement.
- Corrected a problem with setting the Day/Night Transition detect time to 0 causing the camera to constantly switch modes.
- Corrected an issue causing the snapshot via the Web UI and FTP to be very low resolution (640 x 360).

05.30.0.9 Release

New Features and Improvements

- Removed the page for GB/T 28181 from the rest of the Web Client. You can now access it directly at http://Camera_IP/www/gb28181.html.

Major Fixes

- Corrected an issue with the camera's Web and OSD showing 30/12/2020 instead of 30/12/2019 while the streaming and hardware clock was showing the correct time.
- Corrected a problem with the snapshot.jpg feature being accessible on the camera without authentication being required.
- Corrected a problem with the "SD Card Not Present" Event not responding in VideoXpert.

05.30.0.8 Release

New Features and Improvements

- Added the new Pelco logo to the user interface.

Major Fixes

- Corrected a problem preventing auto-backfill from backfilling audio using the camera with VideoXpert.
- Corrected an issue with port scan showing Port 80 is open with TLS set to "Required" in the camera's web client.
- Corrected an issue preventing PTZ patterns from working in Genetec.
- Corrected an issue with created patterns not launching from Live View in the Edge or Firefox browsers.
- Corrected a problem with being unable to start to record a Pattern until after saving it first.
- Corrected an issue causing exported H.265 video in Genetic to appear green.
- Corrected an issue with RTSP over HTTP not streaming in Genetec.
- Corrected a problem with PTZ overlays not displaying during PTZ operations.

05.30.0.4 Release

Major Fixes

- Fixed a memory leak that could lead to camera instability.

Contact Information

Pelco, Inc.
625 W. Alluvial, Fresno, California 93711 United States
USA & Canada Tel: (800) 289-9100, Fax: (800) 289-9150
International Tel: +1(559) 292-1981, Fax: +1(559) 348-1120
www.pelco.com

Pelco, the Pelco logo, and other trademarks associated with Pelco products referred to in this publication are trademarks of Pelco, Inc. or its affiliates. ONVIF and the ONVIF logo are trademarks of ONVIF Inc. All other product names and services are the property of their respective companies. Product specifications and availability are subject to change without notice. © Copyright 2021, Pelco, Inc. All rights reserved.